

High Density Polyethylene (HDPE) Lined Produced Water Evaporation Ponds

N. Nowak, PE, Weaver Boos Consultants, Denver, Colorado, USA

J. Bradish, Danish Flats Environmental Services and Southern Cross Environmental Services, Colorado Springs, Colorado, USA

ABSTRACT

The problem to be solved is the disposal of millions of gallons of production water (brine water) generated annually from the Rocky Mountain Region oil and gas industry in an environmentally safe, low cost, and efficient manner. A technology that is effective and safe is the evaporation of the water in lined containment ponds after separation and removal of the sludge component from the production water.

Two projects are the case studies for this paper. One project is near Cisco, Utah and the other is near Dad, Wyoming and they were designed and constructed to evaporate production water in a series of lined ponds. The production water from oil and gas wells in the area is trucked to the sites for disposal. The water is evaporated in ponds lined with high density polyethylene (HDPE) as the top layer by using a combination of factors that are favorable to the evaporative process, including the following:

- Natural characteristics of the site, including the arid climate, windy conditions, and numerous sunny days,
- The top liner in the ponds is black HDPE, which creates a hot surface, and
- The HDPE liner was used to protect the surface and ground waters of the area and to assist with the evaporation of the water (evaporation is enhanced due to the black color of the liner).

The projects are interesting in that each facility provides oil and gas production companies in the area with a large commercial alternative to production water disposal versus numerous small ponds that may service only one well pad, or expensive re-injection wells. The regulatory agencies like it for centralization and protection of the state's waters. The facilities protect surface waters in the area due to the large capacity of the ponds, 2 feet (Utah) and 3 feet (Wyoming) of freeboard, and secondary containment in case of catastrophic failure (Utah).

1. INTRODUCTION

1.1 Project Location

Danish Flats, Utah

The project is located in an arid region of eastern Utah in the area known as Danish Flat, which is situated at approximately 4,610 feet above mean sea level (amsl). The site is located in Grand County approximately 3.5 miles north of Interstate 70 interchange exit number 214, and approximately 43 miles west of the Utah-Colorado state line.

Background and Site Conditions

The ground surface is privately owned land primarily used for stock grazing and oil and gas transmission piping. No residences are located within 10 miles of the site. Access to the site is over unpaved roads used primarily for oil and gas vehicles.

Topography: The topography at the site slopes gradually from elevation 4,615 ft amsl to 4,600 ft amsl to the southeast. There are no major watercourses on the site.

Geology and Hydrology: The site is located in the Mancos Shale lowland area including the Greater Cisco area. The Mancos Shale Formation is the predominant outcrop in this area. Due to the preponderance of fine-grained sediments and water soluble minerals found in this formation, it does not usually contain any fresh water. Groundwater that comes in contact with the Mancos Shale Formation almost always contains high levels of dissolved solids. Groundwater is usually limited to alluvial deposits along streams and drainages or to sandstone units, some of which are very localized with low recharge rates. Wells in the area are usually drilled with air with little or no water encountered until the Dakota Formation is penetrated (Hunt et al. 1996).

The underlying Mancos shale is a dark grey to black soft shale with sandstone beds at various horizons. The maximum thickness of the Mancos shale is approximately 900 to 1,000 feet. The Mancos shale is considered a confining unit and is a thick barrier to vertical and lateral groundwater flow.

Below the Mancos shale is the lower to upper Cretaceous Dakota Sandstone, which are a yellow-brown and gray friable to quartzitic sandstone and conglomerate sandstone and interbedded gray to black carbonaceous shale with occasional lenticular coal beds (Cashion et al. Map I-736). The Dakota Sandstone is considered to be the first aquifer in the area.

1.1.2 Climatological Data

According to the U.S. Department of Agriculture (USDA) Natural Resources Conservation Service (NRCS) map, the average annual precipitation is six inches. The climate survey for Cisco, UT (closest weather station to site) from 1952 to 1967 according to the Western Regional Climate Center (WRCC) is offered in the following table (re-created from WRCC information).

Table 1. Climate Survey, Cisco, UT

Parameter	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Annual
Avg. Max Temp (F)	37.2	45.7	56.6	68.7	80.3	91.8	98.7	94.3	85.5	72.5	53.4	40.2	68.7
Avg. Min Temp (F)	8.8	17.7	24.0	33.5	43.7	52.1	60.7	58.4	47.3	35.2	22.5	12.5	34.7
Avg. Total Precip. (in.)	0.48	0.50	0.52	0.61	0.61	0.26	0.37	1.03	0.80	0.86	0.63	0.43	7.11
Avg. Total Snow (in.)	4.3	2.1	1.1	0.3	0.0	0.0	0.0	0.0	0.0	0.2	0.9	2.1	11.0

1.1.3 Design Evaporation Data

The National Weather Service developed an isopleths map of the Free Water Surface Evaporation (shallow lake evaporation) based on 24 years of data. The free water surface evaporation rate is the amount expected to evaporate from the disposal ponds, which is 50 inches per year. Approximately 35 inches of that rate occurs from May to October. The remaining 15 inches would evaporate from November to April. This is based on a water containment that is not lined with black HDPE.

1.2 Project Location

Southern Cross, Wyoming

The project is located in an arid region of southwest Wyoming in the area known as Mexican Flat, which is situated at approximately 6,540 feet above mean sea level (amsl). The site is located in Carbon County approximately 5 miles west of Wyoming State Highway 789, approximately 30 miles south of the intersection of highway 789 and Interstate 80 at Wamsutter, and approximately 22 miles north of Baggs, Wyoming.

Background and Site Conditions

The ground surface is privately owned land primarily used for stock grazing and oil and gas transmission piping. No residences are located within 20 miles of the site. Access to the site is over unpaved roads used primarily for oil and gas vehicles.

Topography: The topography at the site slopes gradually from elevation 6,546 ft amsl to 6,536 ft amsl to the northeast. There are no major watercourses on the site.

Geology and Hydrology: The site is located in the Wasatch/Claron Formation. The Claron Formation also referred to as the "Pink Cliffs," forms the highest "step" of the Grand Staircase. This formation is also known as the Wasatch Formation. The site is located in the Cathedral Bluffs Tongue of the Wasatch Formation. This outcropping consists of claystone, mudstone and sandstone. The field investigation and laboratory analysis confirmed the published description to the depth of the deepest boring.

The only known groundwater is at a depth of approximately 700 feet based on a recent boring by Devon Energy. This

boring is on the north side of the property.

1.2.2 Climatological Data

According to the U.S. Department of Agriculture (USDA) Natural Resources Conservation Service (NRCS) map, the average annual precipitation ranges between ten and twelve inches. The climate surveys for Baggs, WY and Wamsutter, WY (the closest weather stations to site) from 1948 to 2007 according to the Western Regional Climate Center (WRCC) are offered in the following tables (re-created from WRCC information).

Table 2. Climate Survey, Baggs, WY

BAGGS, WYOMING (480484) Monthly Climate Summary Period of Record : 9/ 1/1979 to 4/30/2007													
	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Annual
Average Max. Temperature (F)	32.6	36.1	47.6	58.7	68.3	79.3	86.3	83.6	73.9	60.7	43.0	33.8	58.7
Average Min. Temperature (F)	5.2	8.9	20.7	27.9	34.7	41.5	48.1	46.4	37.9	27.6	16.8	7.4	26.9
Average Total Precipitation (in.)	0.44	0.39	0.51	0.87	1.44	0.85	1.16	0.92	1.19	1.35	0.66	0.51	10.29
Average Total Snowfall (in.)	8.4	5.4	5.3	1.9	0.2	0.0	0.0	0.0	0.0	2.0	6.1	8.8	38.2
Average Snow Depth (in.)	0	1	0	0	0	0	0	0	0	0	0	0	0

Table 3. Climate Survey, Wamsutter, WY

WAMSUTTER, WYOMING (489459) Monthly Climate Summary Period of Record : 8/ 1/1948 to 11/30/2004													
	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Annual
Average Max. Temperature (F)	27.9	32.7	41.2	53.7	64.6	75.8	83.9	81.5	72.2	59.0	41.0	29.9	55.3
Average Min. Temperature (F)	7.3	10.5	17.8	26.0	34.2	42.3	49.0	47.1	38.5	28.6	17.1	9.4	27.3
Average Total Precipitation (in.)	0.25	0.24	0.37	0.69	1.05	0.76	0.79	0.79	0.76	0.57	0.34	0.23	6.84
Average Total Snowfall (in.)	4.0	3.4	3.7	2.6	0.8	0.0	0.0	0.0	0.3	1.2	3.3	3.4	22.9
Average Snow Depth (in.)	2	1	1	0	0	0	0	0	0	0	0	1	0

1.2.3 Design Evaporation Data

The National Weather Service developed an isopleths map of the Free Water Surface Evaporation (shallow lake evaporation) based on 24 years of data. The free water surface evaporation rate is the amount expected to evaporate from the disposal ponds, which is 45 inches per year. Approximately 35 inches of that rate occurs from May to October.

The remaining 15 inches would evaporate from November to April. This is based on a water containment that is not lined with black HDPE.

2. PROJECT DETAILS

2.1 Purpose

The purpose of the projects is to evaporate the production water as quickly as possible while maintaining environmental controls and containment.

The projects were planned and built in order to service the oil and gas industry for the specific purpose of the disposal of production water from oil and gas production in the local area. Several produced water disposal options exist, including reinjection wells, frac injection, treatment for surface discharge, and evaporation. The evaporation technology was chosen for these projects due to the ideal site conditions for evaporation, including low precipitation, windy conditions, high ambient temperatures and sun. Other factors that made the project site ideal include the following, no residences within 10 miles of the site, easy access to/from a major highway, long distance to open water at over 7 miles, very deep groundwater, and Mancos Shale at 1,000 feet thick in Utah.

2.2 Selection of Technology

To enhance the evaporative quality of the projects and to adequately contain the brine water, the top layer of the pond lining needs to be a durable long-lasting product that is cost-effective and helps to enhance evaporation while being acceptable to the regulatory agencies involved. Some of the liner technologies considered include compacted clay, geosynthetic clay liner (GCL), polyvinyl chloride (PVC), polypropylene (PPE), and high density polyethylene (HDPE). While several lining technologies exist and are allowed by the regulatory agencies, the HDPE liner was chosen for the top layer for several reasons, including, durability, resistance to ultraviolet degradation, chemical resistance, black color, and ease of construction.

The HDPE is designed to be the top layer of ponds and be exposed to the elements (sun, freeze, and physical impact), therefore, the material needs to be resistant to UV degradation and be durable. The addition of the proper amount of high quality carbon black to the geomembrane during manufacturing is universally accepted as being resistant to significant deterioration caused by weathering. In addition to high quality carbon black, highly effective chemical UV stabilizers further extend the life of the liner. These additives absorb incident radiation and/or terminate free radical production, thus protecting the HDPE against thermal degradation and possible chemical reactions with surrounding materials. Other factors that affect the potential UV resistance of a material include average density, density range or dispersion, chemical stabilizer system, catalyst type and amount of residue, copolymer type, combined chemical exposures, and failure criteria (GSE 2003). HDPE was chosen for this application due to these characteristics.

2.3 Implementation

To enhance the evaporative quality of each facility, and to adequately contain the brine water, high density polyethylene (HDPE) was chosen as the top layer. The liner was designed and constructed with 60-mil thick textured HDPE to help ensure a durable long-lasting containment. The liner was textured to increase the safety factor for personnel using the facility (i.e. the textured surface increases traction and gripping to enable easier egress in case of someone falling into the pond).

The facilities were designed in 2007 by Weaver Boos Consultants, LLC and constructed in 2008 by Kelley Trucking, Inc. and Colorado Lining, Inc., (Pond 3 at Southern Cross was built in 2010) and each consists of the following (refer to Figures 1 and 2 for details):

Access road and truck off-loading pad

Piping and valves

Acceptance Pits (vaults)

Sludge Pond covered with bird control netting

Evaporation ponds

- Danish Flats, UT has 13 ponds at approx. 5.2 acres each and are 12 to 22 feet deep (single HDPE liner)
- Southern Cross, WY has 3 ponds at approx. 5.2 acres each and 12 feet deep (double HDPE liners)

General: Each facility's plan view is shown on the attached drawings. The operation units include one set of 14,000 gallon three-stage concrete receiving tanks, a sludge pond, and a series of five-acre evaporation ponds. All of the structures are connected via gravity or force-main fed underground piping system.

Pond Inlet: All of the incoming water at each site flows through pretreatment tanks (Danish Flats) or one of the three-stage concrete settling tank systems (Southern Cross) and each site uses a the sludge pond before entering the evaporation ponds. The pre-treatment facilities and the evaporation ponds have been designed to follow the topography, allowing for gravity flow throughout the system, and the Danish Flats site is equipped with force-mains to allow pumping of the water from the lower Phase 1 ponds to the upper Phase 2 ponds. Shut-off valves have been installed on the crossover piping to allow for proper flow management. If necessary, portable gasoline powered pumps will be used to transfer liquid to ponds that are not in the gravity flow line or to empty a pond for maintenance or liner repair.

Slope Design: The sludge pond and evaporation ponds have an interior slope of 3 horizontal to 1 vertical, and a maximum exterior slope of 2 to 1. The HDPE chosen has a textured surface, which will increase the safety characteristics of the facility by making it easier to walk on, especially on the interior slopes.

Berm Design: Surface water will not be allowed to enter the ponds because of the constructed berms and the ditches. The interior berm walls will be covered with a protective layer of 60-mil high density polyethylene (HDPE). The HDPE will provide erosion control. The area between the evaporation ponds has been covered with HDPE or compacted clay to prevent erosion, control dust and enhance evaporation. The exterior sides of the berm have been seeded as necessary.

Leak Detection System: As described in the geology/hydrology section of this paper, each site is underlain by impermeable layers of shale, including at Danish Flats approximately 1,200 feet of impermeable shale, and at Southern Cross is located the Wasatch Formation. The first aquifers are below these formations. The geological investigations did not detect perched groundwater. In addition to the ideal natural conditions at each site, a 60-mil HDPE liner has been installed as the top layer in all of the ponds. The pond floors slope toward a sump that is fitted with a monitoring pipe.

The leak detection system is inspected and data recorded on a weekly basis. A summary of the weekly inspections are reported to the regulatory agencies on a quarterly basis. Liquid from the sump can be pumped back into the pond, if excessive amounts accumulate and specific protocols for repairing the liner are required if the volume of the leak exceeds certain thresholds.

Livestock/Wildlife Protection Measures: The entire operations area at each site have been fenced and gated to help prevent cattle or other animals from entering. Since the sludge ponds could have oily material on the surface, netting has been used to deter the entry of birds or other wildlife.

Capacity: The volume of water able to be stored for evaporation in the ponds is as follows:

- Ponds 1 through 8 are 12 feet of water holding depth at Danish Flats and nearly 240,000 barrels each (at 42 gallons per barrel) for a total capacity of approximately 2,000,000 barrels.
- Ponds 9 through 13 are 22 feet of water holding depth at Danish Flats and nearly 632,000 barrels each for a total capacity of 3,160,000 barrels.
- Ponds 1, 2 and 3 are 12 feet of water holding depth at Southern Cross and nearly 240,000 barrels for a total capacity of approximately 750,000 barrels.

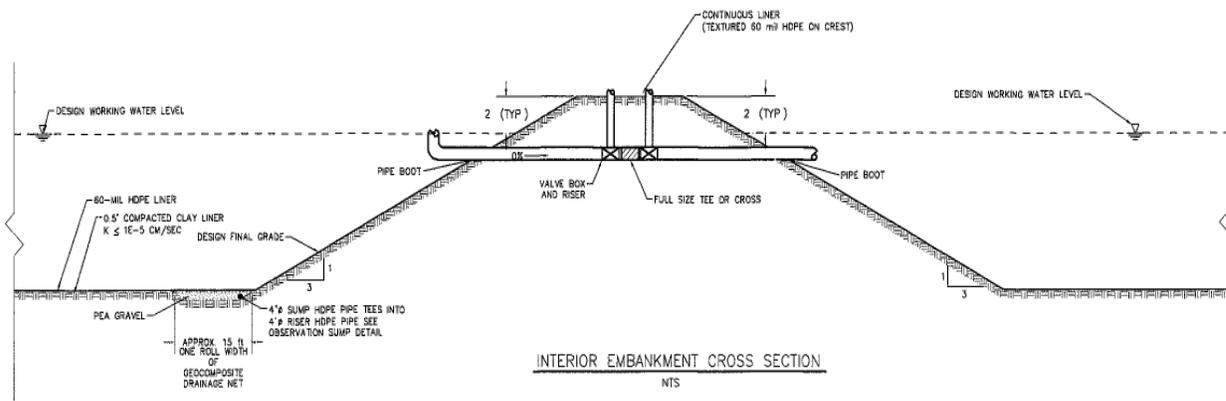


Figure 1 – Danish Flats Pond Liner Details

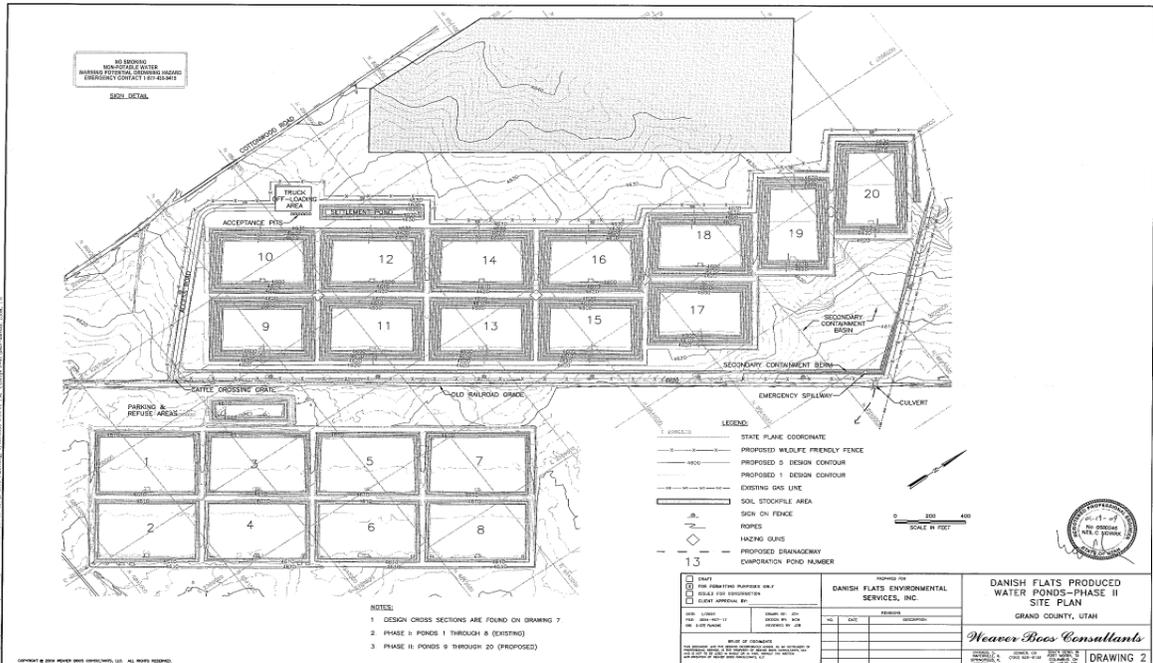


Figure 2 – Danish Flats - Facility Design Plan View – Permit Approved Layout

2.4 Aerial Photo of Completed Project at Danish Flats, UT

The partially completed and partially operational project at Danish Flats was photographed from the air on June 29, 2009 and is shown below. The water was distributed from the sludge pond to the Ponds 1 through 12, which appear as “black”. The Ponds 13 appears to have “brownish” water, which includes some construction water is shown in the background and was not yet approved for water disposal at the time of the photography, but has since been put into operation. Currently, all 13 evaporation ponds are operational at Danish Flats.



2.5 Operational Data

Each facility has experienced various quantities of production water deliveries ranging from 10,000 barrels to 35,000 barrels per day. Each barrel is equal to 42 gallons. The water is moved from the off-loading area through the sludge pond and to the evaporation ponds by gravity or via force main at Danish Flats for distribution to Phase 2. Each pond in Utah has a free board requirement of 2 feet, and each pond in Wyoming has a free board requirement of 3 feet.

When an empty individual evaporation pond was brought on-line, such as Ponds 5 through 8 at Danish Flats, and Pond 2 at Southern Cross, and the water was allowed to flow into the empty pond lined with HDPE, the water was observed as “disappearing” due to the evaporative nature of the HDPE when in combination with the hot sun and arid climate in Utah in July and August.

In Cisco, UT in July and August the ambient air temperatures often exceeds 100 degrees Fahrenheit and the wind normally blows to some extent. The actual evaporation encountered during the months of July and August 2008 at the site was measured to be approximately 15 and 18 inches per day, respectively. The facility operators observed very favorable evaporation of the water and measured the total evaporation for the year 2008 above the estimate of 50 inches for approximately 6 months of operation. In year 2009, the Danish Flats facility was measured to have 60 inches of evaporation, which took place mostly in the months from April 1 to October 31, and again in year 2010 the evaporation total will exceed 60 inches over the entire water surface of the ponds. The deeper ponds at Danish Flats experienced an approximately 30 percent lower evaporation rate due to the deeper water depth, therefore, the entire depth of water was not able to be achieve warmer temperatures as did the shallower ponds.

Each site is equipped with leak detection systems that are monitored on a monthly basis, and for all ponds there has not been any liquid present in the leak sumps, except for two ponds that were adversely affect by shifting ice at HDPE pipe boots when the liquid level in the ponds were adjusted. The liner was easily repaired and there has not been a reoccurrence of any leaks.

3. CONCLUSIONS

The use of HDPE as the primary liner in the ponds appears to be favorably enhancing the evaporation of the water. The estimate of 50 inches of evaporation per year was far exceeded given the 33 inches of evaporation experienced in July and August 2008, only. In years 2009 and 2010, the evaporation rate was over 60 inches. The deeper ponds at Danish Flats experienced approximately a 30 percent lower evaporation rate due to cooler water at depth. The durability and resistance to UV degradation due to the proper amount of carbon black in the geomembrane and other factors as discussed above are the major reasons for the use of the HDPE geomembrane liner as the top layer. The increase with the rate of evaporation due to the black color of the HDPE has been a great benefit. A study was conducted on an HDPE liner installed in Colorado after 20 years of service where the liner was not buried and exposed to weathering, UV light and cooling tower blow-down water. The material was tested for various properties and was found to have no significant reduction in the primary physical properties of the HDPE (Ivy 2002).

ACKNOWLEDGEMENTS

Thank you to Danish Flats Environmental Services and Southern Cross Environmental Services for allowing the use of their projects in this paper. Also, I'd like to recognize Gerald Knudsen, PE of AgriTech who provided his engineering expertise, during the design and permitting for each site, and to John Heap of Colorado Lining, Inc. who performed the construction of the HDPE liners at all 18 ponds in field, which all are performing exceptionally well and without leaks due to construction.

REFERENCES

Cashion, W. B. *Geologic and Structure Map of the Grand Junction Quadrangle, Colorado and Utah, USGS Miscellaneous Geologic Investigations, Map I-736.*

Gundle/SLT Environmental, Inc. (GSE). (2003). *“Technical Note – HDPE, UV Resistance for GSE Geomembranes.”* <http://www.truslate.com/grid/techspec.pdf>.

Hunt, G. L. (1996). *Environmental Handbook, Environmental Regulations for the Oil & Gas Exploration and Production Industry.*

Ivy, N (2002). *HDPE geomembrane after 20 years of service, GFR Magazine June/July 2002.*